

V70 XC (01-) / XC70 (-07), 2006, B5254T2, AW50/51
AWD, L.H.D, YV1SZ595761211090, 211090


26/10/2022



PRINT

Battery, disconnecting

Note before
disconnecting
battery cables

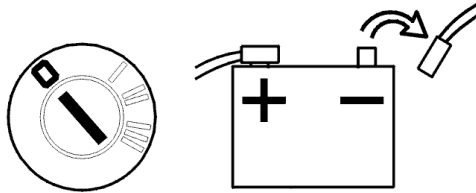

Warning! The SRS (supplemental restraint system) is active for a certain time after the power is cut. Therefore wait three minutes before starting work.


- If the malfunction indicator light in the combined instrument panel is illuminated, the diagnostic trouble codes for the management system must first be read out and remedied before battery power is cut off.
- The ignition should be off for at least five minutes before the battery is disconnected from the car to allow the control modules time to store information.
- If the vehicle is equipped with remote heating, the personal code is reset to the factory value (1234) if the battery is disconnected or is discharged.

Caution! Always disconnect the negative battery cable before disconnecting any positive cables.

Note before
connecting battery
cables

Warning! Ensure that no live objects that can short-circuit the battery are under the battery's protective cover.

Warning! The key must be in

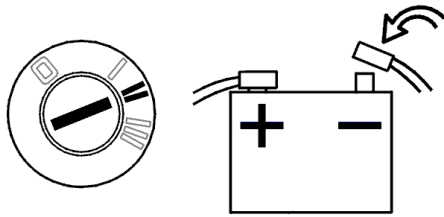

position 2. No one must be in the car when the battery is connected. This is a safety precaution in case an airbag module activates when the power is connected.

Note after connecting battery cables

Initiation of the Upper Electronic Module (UEM)

Initiate the central locking system, interior lighting and sunroof by unlocking the car with the remote control, key or VIDA vehicle communication.

Windows

Initiate window positions. See: VIDA Car communication, Initiating the window position.

Calibrating the passenger compartment fan.

- If the car is equipped with Manual Climate Control (MCC) or Standard climate control system, fan speed must be recalibrated if the battery has been disconnected.
- Ignition on.
- Turn the fan control to max.
- Turn the fan control to min.
- The

calibration
is
complete.

Calibrating the
sunroof

- For S80, S60, V70 (00-) and V70 XC (01-) / XC70 see Sun roof module (SRM), calibrating .
- For XC90 see: Sun roof module (SRM), calibrating .

Engine

- If the battery was disconnected, the engine may need to run for a few minutes before it runs smoothly.

Finishing

Note! Set the clock.

26/10/2022

PRINT